

Great Lakes TV Seal, Inc. is now performing CleverScan manhole inspections. Let us bring an HD virtual tour of the manhole to your office. Software is included at no charge to allow you to take manhole measurements such as circumference, distance, diameters and more right at your desk! With a CleverScan manhole inspection, you have the ability to enter the manhole at any time right from your office and pan every inch of the structure in any direction, all with a cup of coffee in hand! You make the judgement calls, not a field technician. Call us today for details!

GREAT LAKES TV SEAL, INC.

3600 Kewaunee Road Green Bay, WI 54311 Phone: 414-863-3663

CLEANING REPORT

DATE:	9/10/2018			
OWNER:	Heart of the Valley Metropolitan Sewerage District			
LOCATION:	River siphon			
CONTRACTOR:				
TYPE:	Sanitary			

SECTION		PIPE	PIPE	
мн то мн		SIZE	LENGTH	REMARKS:
		(inch)	(feet)	
204	224	00	200	
39A	38A	30	620	The siphon is highly septic and contains heavy amounts of paper and organic
				solids. The hose returned with large clumps of paper, hair, and string.
				As we worked our hose toward the upstream side, with every
				pass we noticed our hose started returning with grease on it. Only the top
				200' of hose returned with grease. A small amount of gravel and grit was
				retrieved on the first few full passes. The line was then cleaned for several
	ł			more hours until the sewage no longer smelled septic and the color
				matched that of the 16" siphon.
	,			The 6" and 16" leg of sewer was plugged at MH 39 sending all the flow thru
				the 30" while cleaning. No flow was noticed in siphon chamber 38
				during this time.

GREAT LAKES TV SEAL, INC.

3600 Kewaunee Road Green Bay, WI 54311 Phone: 414-863-3663

CLEANING REPORT

DATE:	9/11/2018			
OWNER:	Heart of the Valley Metropolitan Sewerage District			
OCATION:	River siphon			
CONTRACTOR:				
YPF.	Sanitary			

SECTION			PIPE	
MH TO) МН	SIZE	LENGTH	REMARKS:
		(inch)	(feet)	
20	20		040	
39	38	6	618	The 6" siphon was plugged upon arrival. We retrieved free floating grease
				cakes from this line, but did not see any settled solids.
39	38	16	618	Retrieved a small amount of grit and grease. We jetted this line until the
				black water subsided and the sewage color matched that of the 6".
				The 30" siphon was plugged on the upstream side sending all the flow
				thru the 6" and 16" while cleaning. No flow was noticed in siphon chamber
				38A during this time.
		I		